

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-001746**Date Inspected:** 07-Mar-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1700**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Xu Le Feng, Ye Yong Jun**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Tower Mock-ups and OBG**Summary of Items Observed:**


The Quality Assurance (QA) Inspector Gregory Bertlesman arrived on site at the Zhenhua Port Machinery Company facility on Changxing island, China to periodically monitor welding and Quality Control functions. While on site the Quality Assurance Inspector observed and/or discovered the following.

Macro Etch Samples

The Quality Assurance Inspector reviewed the macro etch samples for three production monitoring tests for corresponding deck panels DP-057-001 and DP-059-001. In addition the Quality Assurance Inspector reexamined five samples that were returned to ABF with the recommendation for re-etching. In total the Quality Assurance Inspector examined forty samples. The Quality Assurance Inspector recorded the measurements in an onsite log for future review. The Quality Assurance Inspector observed several anomalies and photographed the samples. Below are two digital photographs of anomalies observed on this date.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

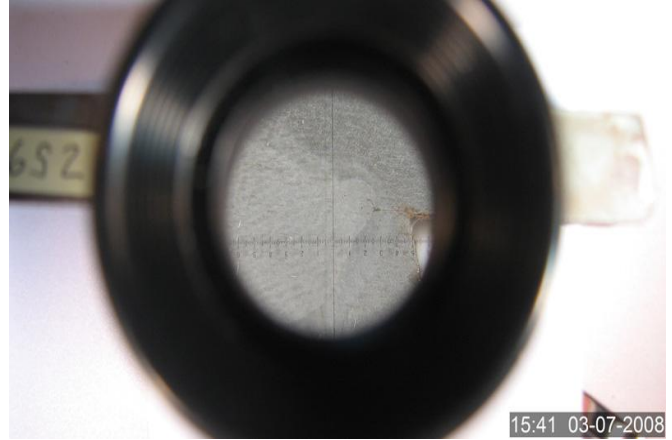

Summary of Conversations:

No relevant conversations on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh, (818) 292-0659, who represents the Office of Structural Materials for your project.

Inspected By:	Bertlesman,Greg
----------------------	-----------------

Quality Assurance Inspector

Reviewed By:	Cuellar,Robert
---------------------	----------------

QA Reviewer
